

VCDS

Windows Based VAG/VAS Emulator Running on Windows 10 x64
VCDS Version: Release 21.3.0(x64) Data version: 20210226 DS325.0
www.Ross-Tech.com

Dealer/Shop Name: ZUM Samar
Workshop Code: 999 00418 012345

Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN
Mileage: 82970km-51555mi Repair Order:

Chassis Type NP-SK48 (3Q0)
Scan: 01 02 03 05 08 09 10 13 14 15 16 17 19 2B 36 3C 42 44 47 4B
52 5F 69 6C 6D 75 A5 BB BC

VIN: TMBJJ7NP7J7532421 Mileage: 82970km-51555miles

01-Engine -- Status: OK 0000
02-Auto Trans -- Status: OK 0000
03-ABS Brakes -- Status: Malfunction 0010
05-Acc/Start Auth. -- Status: OK 0000
08-Auto HVAC -- Status: Malfunction 0010
09-Cent. Elect. -- Status: Malfunction 0010
10-Park/Steer Assist -- Status: Malfunction 0010
13-Auto Dist. Reg -- Status: OK 0000
14-Susp. Elect. -- Status: OK 0000
15-Airbags -- Status: OK 0000
16-Steering wheel -- Status: OK 0000
17-Instruments -- Status: Malfunction 0010
19-CAN Gateway -- Status: Malfunction 0010
2B-Steer. Col. Lock -- Status: OK 0000
36-Seat Mem. Drvr -- Status: OK 0000
3C-Lane Change -- Status: Cannot be reached 0100
42-Door Elect, Driver -- Status: OK 0000
44-Steering Assist -- Status: OK 0000
47-Sound System -- Status: OK 0000
4B-Multifunc. Module -- Status: INTERFACE NOT COMPATIBLE
52-Door Elect, Pass. -- Status: OK 0000
5F-Information Electr. -- Status: Malfunction 0010
69-Trailer -- Status: OK 0000
6C-Back-up Cam. -- Status: OK 0000
6D-Trunk Elect. -- Status: OK 0000
75-Telematics -- Status: OK 0000
A5-Frt Sens. Drv. Assist -- Status: Malfunction 0010
BB-Door Rear Drv -- Status: OK 0000
BC-Door Rear Pass -- Status: OK 0000

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 2

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 01: Engine (J623-DFCA) Labels: 04L-907-309-V1.clb
Part No SW: 04L 906 026 FN HW: 04L 907 309 M
Component: R4 2.0l TDI H25 2011
Revision: B4H25---
Coding: 011D0032047405083000
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_ECM20TDI01104L906026FN_004002
ROD: EV_ECM20TDI01104L906026FN_004.rod
VCID: 7BF542EBF2E5695396-802E

No fault code found.
Readiness: 0 0 0 0 0

Address 02: Auto Trans (J743) Labels: 0D9-927-770.clb
Part No SW: 0D9 300 043 C HW: 02E 927 770 AS
Component: DQ250-6F MQB H54 5201
Revision: 06454104 Serial number: TFK01707123540
Coding: 0014
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_TCMDQ250021 001001
ROD: EV_TCMDQ250021.rod
VCID: 1A3B676F1D9FB05B2D-804E

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 3

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 03: ABS Brakes (J104) Labels: 5Q0-907-379-IPB-V1.clb

Part No SW: 5Q0 614 517 CH HW: 5Q0 614 517 AH

Component: ESC H62 0743

Revision: 00000000 Serial number: 62577000001952

Coding: 1E076A9C34230B6E477B060240C44978562CD0E2600292753861F0F8C2A9420000000012121212B8353519

Shop #: WSC 33361 790 00137

ASAM Dataset: EV_Brake1UDSContiMK100IPB 036010

ROD: EV_Brake1UDSContiMK100IPB_036_VW37.rod

VCID: 79F958E3F8D95B4384-802C

1 Fault Found:

8364 - Databus

U1122 00 [009] - Implausible Message

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 3

Fault Frequency: 6

Reset counter: 23

Mileage: 82923 km

Date: 2022.08.25

Time: 17:23:16

Address 05: Acc/Start Auth. (J518) Labels: 5Q0-959-435.clb

Part No SW: 3Q0 959 435 G HW: 3Q0 959 435 G

Component: VWKESYMQB 037 0906

Revision: 00037000 Serial number: 0455505744

Coding: 032C0C070F

Shop #: WSC 33361 790 00137

ASAM Dataset: EV_KessyHellaMQBAB 004041

ROD: EV_KessyHellaMQBAB.rod

VCID: 3E738BFFA177BC7BF1-806A

Rear lid opener control module:

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 4

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 08: Auto HVAC (E87) Labels:| 3V0-907-044.clb
Part No SW: 3V0 907 044 CK HW: 3V0 907 044 CK
Component: AC Automat H34 4402
Revision: 20K10000 Serial number: 00000B00656432
Coding: 1201010400241001100510010010112A
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_ACClimaPrehVW37X 002025
ROD: EV_ACClimaPrehVW37X_002_VW37.rod
VCID: 7F0DB6FBE6FD7573BA-802A

Humidity sensor: exterior:

Rear A/C control head:
Subsystem 2 - Part No SW: 3V0 907 049 E HW: 3V0 907 049 E
Component: E265KlimaHeck H02 0101
Serial number: 06051501850797
Coding: 000000

1 Fault Found:

263425 - Air Quality Sensor

B10AF 04 [009] - Internal System Fault

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 3

Fault Frequency: 15

Reset counter: 23

Mileage: 82923 km

Date: 2022.08.25

Time: 17:24:09

Outside temperature: 44.0 °C

Voltage terminal 30: 12.0 V

System run time-Engine running time: 0 s

System run time-Terminal 15 on: 253 s

Air quality status: Malfunction

System run time-Engine running time: 0 s

System run time-Terminal 15 on: 253 s

Page 5

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 6

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 10: Park/Steer Assist (J791) Labels:| 5Q0-919-298.clb
Part No SW: 5QA 919 298 C HW: 5QA 919 298 A
Component: PLA 3.0 12KH07 0045
Serial number: 000308417617244
Coding: 0271167951
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_EPHVA2CAU3700000 009037
ROD: EV_EPHVA2CAU3700000.rod
VCID: 50AFC5470BE33A0B13-8004

1 Fault Found:

13688835 - Databus

U1123 00 [009] - Received Error Message

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 6

Fault Frequency: 2

Reset counter: 23

Mileage: 82923 km

Date: 2022.08.25

Time: 17:37:22

Address 13: Auto Dist. Reg (J428) Labels:| 3Q0-907-572.clb
Part No SW: 3Q0 907 572 C HW: 3Q0 907 572 C
Component: ACC BOSCH MQB H04 0195
Coding: 320067CB55FFC428949C8045
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_ACCBOSCHVW48X 001009
ROD: EV_ACCBOSCHVW48X.rod
VCID: 356194D394417F2320-8060

No fault code found.

Address 14: Susp. Elect. (J250) Labels: 5Q0-907-376.clb
Part No SW: 5Q0 907 376 B HW: 5Q0 907 376 A
Component: DAEMPFUNGS-SG H17 0121
Serial number: 25081741350765
ASAM Dataset: EV_DRCONTITEMIC 001019
ROD: EV_DRCONTITEMIC_VW37.rod
VCID: 387F9DE78353824B3B-806C

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 7

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 15: Airbags (J234) Labels:| 5Q0-959-655.clb
Part No SW: 5Q0 959 655 BH HW: 5Q0 959 655 BH
Component: AirbagVW21 005 0336
Serial number: 003VVR3D2P9F
Coding: 98CCC0C0000000005C5400CF004800000065
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_AirbaVW20SMEVW37X 002158
ROD: EV_AirbaVW20SMEVW37X_VW37.rod
VCID: 071D2E1BBE2D3DB382-8052

Crash sensor for side airbag: driver side:
Subsystem 1 - Part No SW: ----- HW: 480 000 909 17
Component: SideSensor_Df 001 0887
Serial number: 35700000000EF318472Q
Coding: 2D2D2D

Front Passenger's Side Airbag Crash Sensor:
Subsystem 2 - Part No SW: ----- HW: 480 000 909 17
Component: SideSensor_Pf 001 0887
Serial number: 35800000000D7970F62W
Coding: 2D2D2D

Rear Side Airbag Crash Sensor (on driver's side):
Subsystem 3 - Part No SW: ----- HW: 480 402 009 17
Component: SideSensor_Dr 000 6149
Serial number: 3510001A724A4334D4C0
Coding: 2D2D2D

Passenger side rear thorax airbag crash sensor:
Subsystem 4 - Part No SW: ----- HW: 480 401 509 17
Component: SideSensor_Pr 000 6149
Serial number: 3520001B526E2755E4CC
Coding: 2D2D2D

Crash sensor for front airbag: driver side:
Subsystem 5 - Part No SW: ----- HW: 480 401 409 17
Component: FrontSensor_D 000 6149
Serial number: 3550001C125187C6728%
Coding: 2D2D2D

No fault code found.

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 16: Steering wheel (J524) Labels:| 5Q0-953-549.clb
Part No SW: 5Q0 953 521 GE HW: 5Q0 953 569 A
Component: Lenks.Modul 075 0235
Revision: FF035035 Serial number: 20170918500067
Coding: 6414
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_SMLSVALEOMQB 001015
ROD: EV_SMLSVALEOMQB.rod
VCID: 7BF542EBF2E5695396-802E

No fault code found.

Address 17: Instruments (J285) Labels:| 5G0-920-XXX-17.clb-SRI3
Part No SW: 3V0 920 751 B HW: 3V0 920 751 B
Component: KOMBI 301 0310
Coding: 07A5091A7F84000801886B0B5001000800000000
Shop #: WSC 73430 031 00137
ASAM Dataset: EV_DashBoardVDDMQBAB 009060
ROD: EV_DashBoardVDDMQBAB_009_VW26.rod
VCID: 3365AACB9A3561130E-8066

2 Faults Found:

16777008 - Function Restricted due to Interrupted Communications

U1110 00 [009] - -

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 6

Fault Frequency: 1

Reset counter: 21

Mileage: 82923 km

Date: 2022.08.25

Time: 17:24:51

16776982 - Databus

U1121 00 [009] - Missing Message

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 6

Fault Frequency: 1

Reset counter: 21

Mileage: 82923 km

Date: 2022.08.25

Time: 17:24:48

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 19: CAN Gateway (J533) Labels:| 3Q0-907-530-V1.clb
Part No SW: 3Q0 907 530 G HW: 3Q0 907 530 C
Component: GW MQB High 518 5304
Serial number: 14091710522425
Coding: 0B0100345F087300EB00025A9C0F00010001070000000000000000000000
Shop #: WSC 33361 790 00160
ASAM Dataset: EV_GatewNF 013023
ROD: EV_GatewNF_VW37.rod
VCID: 3365AACB9A3561130E-8066

Generator:

Multifunction steering wheel control module:
Subsystem 2 - Part No SW: 3V0 919 719 B HW: 3V0 919 719 B
Component: E221__MFL-PR6 H02 0160
Serial number: 000000000C0800060917

Battery Monitoring Control Module:
Subsystem 3 - Part No SW: 5Q0 915 181 K HW: 5Q0 915 181 K
Component: J367-BDMHella H10 9070
Serial number: 6239925204

Inverter for electrical outlet:
Subsystem 4 - Part No SW: 5Q0 907 155 B HW: 5Q0 907 155 B
Component: U13DCAC H25 0780
Serial number: 0061717

1 Fault Found:

131662 - Lane change assistant control module
U1045 00 [009] - No communication
[New feature! Extended UDS fault detail is only supported by current gen. interfaces]
Confirmed - Tested Since Memory Clear
Freeze Frame:

Fault Status: 00000001
Fault Priority: 2
Fault Frequency: 17
Reset counter: 23
Mileage: 82923 km
Date: 2022.08.25
Time: 17:22:18

Terminal 30 power supply: 12.0 V
Terminal 15: On

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 10

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 2B: Steer. Col. Lock (J764) Labels:* 5Q0-905-861.clb
Part No SW: 3Q0 905 861 HW: 3Q0 905 861
Component: ELV-MQBB H05 0032
Serial number: 17000247565003
Coding: 0800000000000000
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_ELVMarquMQBB 001007
ROD: EV_ELVMarquMQBB.rod
VCID: 71E960C3A0A913033C-8024

No fault code found.

Address 36: Seat Mem. Drvr (J810) Labels:* None
Part No SW: 5Q0 959 760 B HW: 5Q0 959 760 B
Component: Sitzmemory H08 0022
Serial number: Y0006QIE11622
Coding: 001000000000050001828080808000000008181000000D400
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_SeatMemorDriveSide 002021
ROD: EV_SeatMemorDriveSide.rod
VCID: 3C7781F7B76BAE6BDF-8068

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 11

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 3C: Lane Change (J1086) Labels:| 5Q0-907-686.clb
Part No SW: 5Q0 907 686 C HW: 5Q0 907 686 C
Component: HRE_Master H12 0080
Serial number: 0454106027
Coding: 00000000
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_HREntryHella 001028
ROD: EV_HREntryHella_VW37.rod
VCID: 3D718CF3AC71A763E8-8068

Lane change assistance control module 2:
Subsystem 1 - Part No SW: 5Q0 907 685 C HW: 5Q0 907 685 C
Component: HRE_Slave H12 0080
Serial number: 0454026860
Coding: 000000

3 Faults Found:

266752 - Control module not coded

U1013 00 [009] - -

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 3

Fault Frequency: 1

267520 - invalid data record

B2005 00 [009] - -

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 3

Fault Frequency: 3

267776 - Data Set Implausible

B2012 00 [008] - -

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Intermittent - Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 3

Fault Frequency: 1

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 12

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 42: Door Elect, Driver (J386) Labels:| 5QX-959-X93-42.clb
Part No SW: 5Q4 959 593 E HW: 5Q4 959 593 B
Component: TSG FS 011 0032
Serial number: 0000278792879
Coding: 001D0920DE00040000001100
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_DCUDriveSideEWMAXCONT 006001
ROD: EV_DCUDriveSideEWMAXCONT.rod
VCID: 479DEE1BFEADFDB342-8012

No fault code found.

Address 44: Steering Assist (J500) Labels:| 5Q0-909-143.clb
Part No SW: 5Q0 909 143 P HW: 5Q0 909 143 E
Component: MQB_PP_APA 204 2051
Revision: 00000000 Serial number: 0002001542
Coding: 01010011004001
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_SteerAssisVWBSMQBA 009129
ROD: EV_SteerAssisVWBSMQBA_009.rod
VCID: 408FF507DB83CA8B83-8014

No fault code found.

Address 47: Sound System (J525) Labels:| 81A-035-466.clb
Part No SW: 81A 035 223 HW: 81A 035 223
Component: MIB2_amp_P_SK H10 0410
Revision: 00000001 Serial number: SKZ8Z1HJE02QSP0
Coding: 0384020000AA002FAA0000000000
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_AMPMst16C5Gen2ALPI 001001
ROD: EV_AMPMst16C5Gen2ALPI.rod
VCID: 59B9386358197B43E4-800C

No fault code found.

Address 4B: Multifunc. Module
Interface not compatible.
Please upgrade to a current Ross-Tech interface.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 13

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 52: Door Elect, Pass. (J387) Labels:| 5QX-959-X92-52.clb
Part No SW: 5Q4 959 592 E HW: 5Q4 959 592 B
Component: TSG BFS 011 0032
Serial number: 0000278382460
Coding: 001D0320DE000400000001100
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_DCUPasseSideEWMAXCONT 006001
ROD: EV_DCUPasseSideEWMAXCONT.rod
VCID: 4683E31FF9A7E4BBB9-8012

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 14

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 5F: Information Electr. (J794) Labels:| 3V0-035-MIB-HGH2.clb
Part No SW: 565 035 021 A HW: 565 035 021
Component: MU-H-LND-EU H54 1163
Serial number: A853I0HB034909
Coding: 03840201000000005111120200880A332F0100E4012005009E
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_MUHig4CGen2HBAS 001001
ROD: EV_MUHig4CGen2HBAS_AU37.rod
VCID: 0C171137A74B5EEBAF-8058

Display and control head 1 for information electronics:
Subsystem 1 - Part No SW: 3V0 919 606 D HW: 3V0 919 606 D
Component: ABT_High-2 H50 9130
Serial number: SKZ6ZHT2451933

Data carrier:
Subsystem 2 - Part No SW: V03 959 818 H HW: -----
Component: ECE 2022/2023 --- 0197
Serial number: -----

Compact disc data bank:
Subsystem 3 - Part No SW: V03 959 800 EG HW: -----
Component: Gracenote2 --- 1016
Serial number: -----

1 Fault Found:

7194 - Function Restricted due to Missing Message(s)

U1111 00 [009] - -

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 6

Fault Frequency: 1

Reset counter: 21

Mileage: 82923 km

Date: 2022.08.25

Time: 17:22:23

Voltage terminal 30: 12.2 V

BAP-BAP_Function_ID: 02

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 15

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address 69: Trailer (J345) Labels:| 5Q0-907-383.clb
Part No SW: 5Q0 907 383 M HW: 5Q0 907 383 M
Component: Anhaenger H27 0260
Revision: 8B001004 Serial number: 0452651005
Coding: 0100000202000000
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_TrailFunctGener2Hella 001008
ROD: EV_TrailFunctGener2Hella_VW26.rod
VCID: 4189F003D089C3838C-8014

No fault code found.

Address 6C: Back-up Cam. (J772) Labels:| 5Q0-980-556.clb
Part No SW: 5Q0 980 556 B HW: 5Q0 980 556 B
Component: RVC Compact H12 0231
Coding: 04840201A700201F000040
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_CamSysRVRVCPANAMQBAB 006009
ROD: EV_CamSysRVRVCPANAMQBAB.rod
VCID: 397998E3B8599B43C4-806C

No fault code found.

Address 6D: Trunk Elect. (J605) Labels:| 5Q0-959-107.clb
Part No SW: 5Q0 959 107 L HW: 5Q0 959 107 J
Component: HDSG-Modul H13 0261
Revision: ----- Serial number: 31555676100000
Coding: 0D88
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_DeckLidCONTIAU736 001014
ROD: EV_DeckLidCONTIAU736_VW37.rod
VCID: 4189F003D089C3838C-8014

No fault code found.

Address 75: Telematics (J949) Labels:| 5QE-035-285.clb
Part No SW: 5NA 035 284 B HW: 5NA 035 284 B
Component: OCULowMQBLGE H17 0717
Revision: -----
Coding: 03840201EA421A0D3B1C9E000045400382E608
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_OCULowMQBLGE 004044
ROD: EV_OCULowMQBLGE_004_VW25.rod
VCID: 3C7781F7B76BAE6BDF-8068

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 16

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address A5: Frt Sens. Drv. Assist (R242) Labels:| 3Q0-980-65X-A5.clb
Part No SW: 3QD 980 654 HW: 3Q0 980 654 A
Component: MQB_B_MFK H08 1272
Serial number: 23081741P20105
Coding: 020408020000040100262355C150A90098000E100040
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_MFKBoschMQBB 001001
ROD: EV_MFKBoschMQBB_001_VW36.rod
VCID: 081F2D27B33332CB8B-805C

1 Fault Found:

1122649 - Databus

U1121 00 [009] - Missing Message

[New feature! Extended UDS fault detail is only supported by current gen. interfaces]

Confirmed - Tested Since Memory Clear

Freeze Frame:

Fault Status: 00000001

Fault Priority: 6

Fault Frequency: 1

Reset counter: 23

Mileage: 82923 km

Date: 2022.08.25

Time: 17:26:12

Control Module temperature: 60 °C

Outside temperature: 33.5 °C

Vehicle speed: 0.00 km/h

System run time: 804.7 s

Voltage terminal 15: 12.0 V

mid: 02 0B

Status of camera: operational

Engine_Running_Info: 0

Software_Info_4: 2

Software_Info_3: 7

Software_Info_2: 2

Software_Info_1: 1

Address BB: Door Rear Drv (J388) Labels:* None
Part No SW: 5Q4 959 395 E HW: 5Q4 959 395 B
Component: TSG HFS 012 0032
Serial number: 0000275853255
Coding: 001801208000040000001100
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_DCURearDriveMAXCONT 006001
ROD: EV_DCURearDriveMAXCONT.rod
VCID: 479DEE1BFEADFDB342-8012

No fault code found.

VCDS
Self-Diagnosis Log
Friday,26,August,2022,19:55:31:00009
Page 17

VIN: TMBJJ7NP7J7532421 License Plate: MAR CIN

Address BC: Door Rear Pass (J389) Labels:* None
Part No SW: 5Q4 959 395 E HW: 5Q4 959 395 B
Component: TSG HBFS 012 0032
Serial number: 0000277611596
Coding: 0018012080000400000001100
Shop #: WSC 33361 790 00137
ASAM Dataset: EV_DCURearPasseMAXCONT 006001
ROD: EV_DCURearPasseMAXCONT.rod
VCID: 479DEE1BFEADFDDB342-8012

No fault code found.

End------(Elapsed Time: 06:46)-----